

TPS-6X Battery Calibration Notice:

For optimum performance after shipping or any time the power switch has been off for an extended period of time, Crestron recommends the following procedure be performed:

1. Turn the battery switch on the rear of the unit ON (slide it upward).
2. Place the unit on its charger/docking station and connect AC power.
3. Allow the unit to charge completely.
(The green LED should be steady on for 15 minutes.)
4. Set Standby Timeout and Power Timeout in the Setup menu to zero.*
5. Remove panel from the docking station.
6. Leave the unit powered on and allow it to fully discharge, ignoring low power warnings.
 - a. When the screen goes black, touch the screen to turn on the display backlight.
 - b. When screen goes black again, the battery is fully discharged.
7. Place the unit on its charger/docking station again.
8. Restore Standby Timeout and Power Timeout values in the Setup menu by pressing “Restore Power Settings” or set as desired.
9. Allow the unit to charge completely.
10. Unit is now ready for normal operation.

* Refer to “Configuring the Touchpanel” in the latest version of the TPS-6X Operations Guide (Doc. 6575).

For other questions regarding the TPS-6X, please feel free to contact our award winning:



True Blue Customer Support Team



Call Crestron at 1-888-CRESTRON [1-888-273-7876].

You can also log onto the online help section of the Crestron website (www.crestron.com/onlinehelp) to ask questions about Crestron products. First-time users need to establish a user account to fully benefit from all available features.



Crestron Electronics, Inc.
15 Volvo Drive, Rockleigh, NJ 07647
Tel: 888.CRESTRON Fax: 201.767.7576
www.crestron.com

Specifications subject to
change without notice.
(2022018)
DOC. 6732A 07.08